

SECRET

12 NOV 1963

SECRET 091525Z

OUT-52266

1963 NOV 9 17 06Z

25X1

1. CAMERA B 8 WAS USED IN MISSION 3768 FLOWN 6 NOV 63; PROCESSING WAS ACCOMPLISHED BY NAVY PIC.

2. ORIGINAL NEGATIVE

A. THE EXPOSURE IS ADEQUATE AND THE RESOLUTION IS FAIR DUE TO THE GRAINY APPEARANCE OF THE IMAGERY.

HFS

B. 9R SIDE: A HEAT SPLICE IS PRESENT THROUGH FRAMES 586 AND 1285. A FEW SCATTERED PINHOLES ARE NOTED THROUGHOUT THIS MISSION.

CJS

CPC

PLS

ACL

C. 9L SIDE: A HEAT SPLICE IS PRESENT THROUGH FRAMES 597 AND 1307. ASSOCIATED WITH THE LATTER SPLICE ARE CRIMPS AND EMULSION DIGS ON FRAMES 1307 AND 1308. SKIVING ADHERING TO THE TRAILING EDGE OF THE FRAME FORMAT RESULTS IN A MINOR OBSTRUCTION ON EVERY FRAME THROUGHOUT THE MISSION. A MINUS DENSITY DOTS OCCURS 3.12" FROM THE OUTBOARD EDGE OF THE FILM ON FRAME 1888. A FEW SCATTERED PINHOLES AND BLISTERS OCCUR THROUGHOUT THIS SIDE.


Grace (File)

D. BOTH SIDES: THE METERING IS ERRATIC WITH NO OVERLAPPING FORMATS NOTED. THE DATA CHAMBER CLOCK IS READABLE BUT SLIGHTLY OVEREXPOSED. THE INDICATOR LAMPS FLUCTUATED IN INTENSITY THROUGHOUT

Declassification Review by NGA/DoD

25X1

SECRET

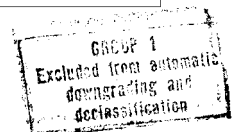

THIS MISSION, WITH THE IL POSITION LAMP OPERATING INTERMITTENTLY. A REFLECTION FROM THE FRAME FORMAT APPEARS THROUGHOUT, WITH OCCASIONAL, RAIL FLARE ON THE LEADING AND OUTBOARD EDGE POSSIBLY DUE TO VEHICLE MANEUVERING.

E. THERE WERE NO MAJOR CAMERA MALFUNCTIONS OR PROCESSING PROBLEMS ENCOUNTERED DURING THIS MISSION.

3. POSITIVE

A. PI SUITABILITY IS FAIR DUE TO THE GRAINY APPEARANCE OF THE IMAGERY.

B. PRINTING AND PROCESSING ARE GOOD.

C. CLOUDS OBSCURE APPROXIMATELY 20 PERCENT OF THE MISSION.

S E C R E T

END OF MESSAGE

1